

## Accessibility Site Visit Report - HC - ANSI

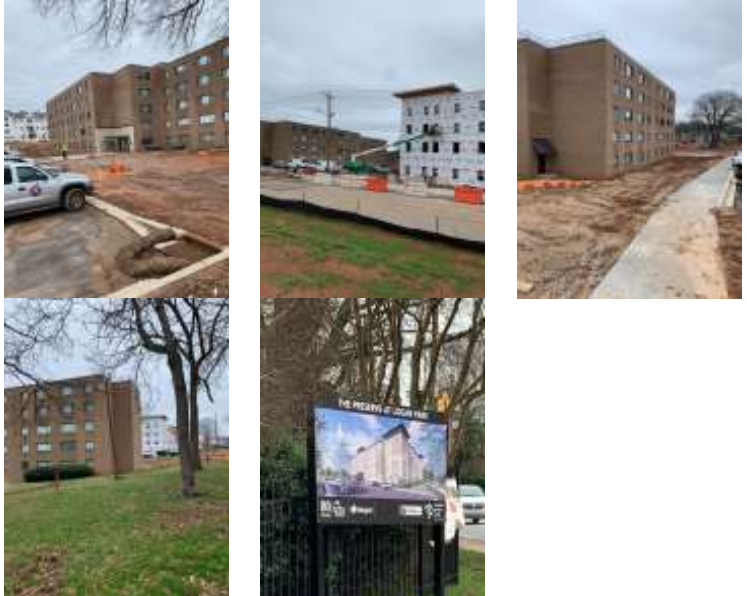
### CONTACT INFORMATION

<b>Accessibility Consultant</b>	<p><b>ZEFFERT &amp; ASSOCIATES</b> 12101 Woodcrest Executive Drive Suite 180 St. Louis, MO 63141 Fred Donnell, Jr. - Manager, Inspection Services <a href="mailto:fdonnell@zeffert.com">fdonnell@zeffert.com</a> Office: 314.336.4869 Cell: 636.697.4151</p>
---------------------------------	--

### PROJECT INFORMATION

<b>Project Name</b>	Sample Property
<b>Visit Type</b>	3rd
<b>Date of Inspection</b>	02-12-2020
<b>Inspector</b>	Brian White
<b>Site Visit Accompaniment</b>	Jason Pendly
<b>Street Address</b>	123 Main St
<b>City</b>	Greenville
<b>State</b>	South Carolina
<b>Zip Code</b>	29605
<b>Accessibility Codes for this project (Check if used)</b>	2010 ADA, ANSI A117.1, UFAS
<b>Number of Buildings</b>	1
<b>Total Number of Units</b>	80
<b>Number of HC Accessible Units</b>	5
<b>Number of A/V Units</b>	0
<b>Number 1 Bedroom Units (Std/HC)</b>	80/5
<b>General Project Notes:</b>	NOTE – Element Findings at Time of Inspection: This inspection report indicates individual elements as Yes, No, or N/A. Each

## Accessibility Site Visit Report - HC - ANSI

	<p>element listed as Yes is compliant and requires no action. Each element listed as No is not compliant and requires action. Each element listed as N/A is non-applicable and requires no action or not installed at the time of inspection.</p>
<b>General Project Photos</b>	

## Accessible Parking

<b>Location of Parking</b>	Main Entrance
<b>HC Parking Status</b>	Under Construction
<b>Surface type</b>	Asphalt


## Accessibility Site Visit Report - HC - ANSI

### Accessible Parking Photos



<b>Location of Parking</b>	Basement Entrance
<b>HC Parking Status</b>	Finished
<b>Surface type</b>	Asphalt
<b>HC parking spaces the closest parking to the nearest location: (2010 ADA 208.3.1 UFAS: 4.6.2 FHA 2.20)</b>	Yes
<b>Parking space at least 96" wide (ADA 502.2 UFAS 4.6.3 FHA 2.21)</b>	Yes
<b>Is access aisle the full length of the parking space (ADA 502.3.2 UFAS 4.6.3 FHA 2.21)</b>	Yes
<b>Is access aisle proper width 5' (ADA 502.3.1 UFAS 4.6.3 FHA 2.21)</b>	Yes
<b>Is the slope and cross-slope of parking space no more than 2% in all directions (ADA 502.4 UFAS 4.6.3)</b>	Yes
<b>Is the slope and cross-slope of access aisle no more than 2% in all directions (ADA 502.4 UFAS 4.6.3)</b>	Yes
<b>Does each HC parking space have a sign with ISA mounted at least 60" above the</b>	No


## Accessibility Site Visit Report - HC - ANSI

space to the bottom of the signage (ADA 502.6 UFAS 4.6.4 FHA 2.21)	
Curb ramp slope does not exceed 8.33% (ADA 405.2 UFAS 4.8.2)	Yes
Curb ramp cross-slope no more than 2% (ADA 405.3 UFAS 4.8.6)	Yes
Curb ramp at least 36" wide (Flared sides) 48" min. C/I ramp (ADA 405.5 UFAS 4.8.3)	Yes
Cut-In curb ramp landing at least as wide as curb ramp and adjoining accessible route (UFAS 4.8.4)	Yes
Accessible Parking Photos	


## Accessibility Site Visit Report - HC - ANSI



## ACCESSIBLE ROUTE

<b>Accessible Route Location</b>	Main Entrance from HC Parking
<b>Status of accessible route</b>	Partial
<b>Add Photos of Accessible Route</b>	

## Accessibility Site Visit Report - HC - ANSI

<b>Accessible Route Location</b>	Basement Entrance from HC Parking
<b>Status of accessible route</b>	Finished
<b>Where the accessible route on the site crosses a vehicular roadway, crosswalk lines are provided.</b>	N/A
<b>Accessible route a minimum of 36" (ADA 403.5.1 UFAS 4.3.3)</b>	Yes
<b>Cross-slope is no more than 2% (ADA 403.3 UFAS 4.3.7)</b>	Yes
<b>Forward slope doesn't exceed 5% for a horizontal run over 6 feet and will not require handrails. (ADA 403.3)</b>	Yes
<b>No protruding objects (fire extinguishers, signs, light fixtures, shelves, etc.) project more than 4" between 27" and 80" (ADA 307.3 UFAS 4.4.1)</b>	Yes
<b>18" min clearance with firm surface provided on pull side of the gate (ADA 404.2.4.1)</b>	Yes
<b>Add Photos of Accessible Route</b>	

## Accessibility Site Visit Report - HC - ANSI

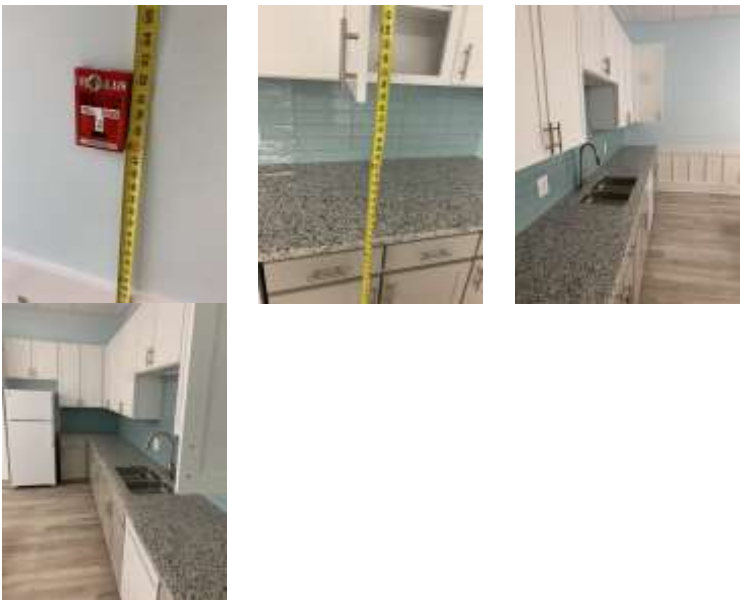
### COMMUNITY/COMMON AREAS

#### Community Kitchen

Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ADA 404.2.3)	Yes
Threshold less than 1/2" with bevel or 1/4" no bevel (ADA 404.2.5)	Yes
Interior signs mounted (latch side) have tactile characters (measured from the baseline) between 48" min. - 60" max. (ADA 703.4.1)	Yes
Interior sign characters at least 5/8" but no more than 2" tall (ADA 703.5.5)	Yes
Electric switches/outlets 44" max. AFF over workspace others behind counter 46" max. AFF (ADA 308.2.2 (b))	Yes
Kitchen counters 34" max. AFF (ADA 804.3.2)	Yes
Top lip of kitchen sink 34" max. AFF (ADA 606.3)	Yes
Kitchen sink has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ADA 306)	Yes
Are drain and water supply pipes insulated or covered by skirt (ADA 606.5)	Yes
Faucet controls Lever Handle style or easy to operate (ADA 309.4)	Yes
Pass through kitchen has 40" min. clear width (ADA 804.2.1)	Yes
At least 50% of shelf space within 48" max - 15" min AFF (ADA 804.5)	No



## Accessibility Site Visit Report - HC - ANSI

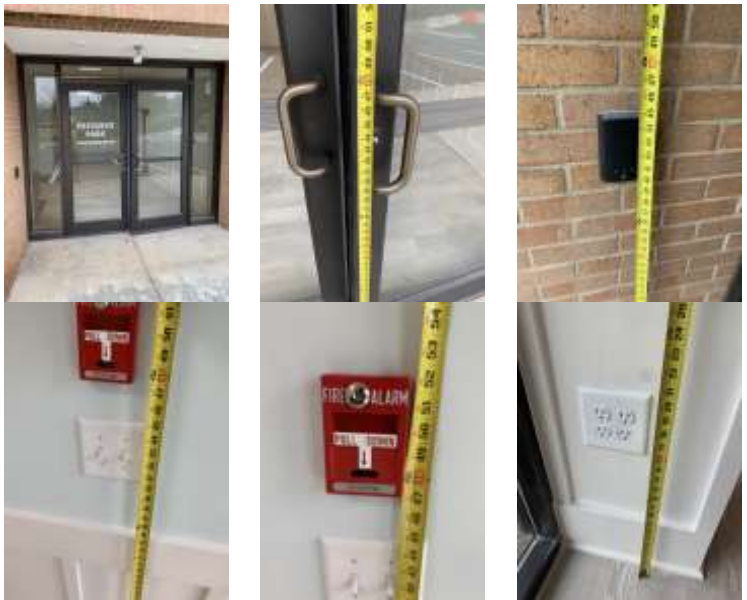
<b>Cabinet hardware easily operated with one hand (ADA 309)</b>	Yes
<b>Refrigerator has 50% of freezer space below 54" max. AFF (ADA 8.4.6.6)</b>	Yes
<b>If required per NFPA fire alarm pull station permanently installed 48" max. AFF</b>	
<b>Common Kitchen Photos</b>	

## Community Room

<b>Status of this area</b>	Finished stage
<b>Doorway has a clear opening width 32" min. (ADA 404.2.3)</b>	Yes
<b>Door hardware does not require tight grasping or twisting to operate (ADA 404.2.7 309.4)</b>	Yes
<b>Threshold less than 1/2" with bevel or 1/4" no bevel (ADA 404.2.5 UFAS 4.13.8)</b>	Yes



## Accessibility Site Visit Report - HC - ANSI

<b>12" min. clearance on the push side of the door (with door closure) (ADA 404.2.1)</b>	Yes
<b>Does the door take at least 5 seconds to close (2010 ADA 404.2.8.1)</b>	Yes
<b>Electric switches 48" max. AFF and outlets 15" min. (unobstructed) (ADA 308.2.1)</b>	Yes
<b>Interior signs mounted (latch side) have tactile characters (measured from the baseline) between 48" min. - 60" max. (ADA 703.4.1)</b>	Yes
<b>Interior sign characters at least 5/8" but no more than 2" tall (ADA 703.5.5)</b>	Yes
<b>If required per NFPA fire alarm pull station permanently installed 48" max. AFF</b>	No
<b>Community Room Photos</b>	

## Accessibility Site Visit Report - HC - ANSI



### Drinking Fountain

<b>Location of drinking fountain</b>	Basement Entrance
<b>Status of Drinking Fountain</b>	Operable
<b>Knee clearance at least 27" min. (ADA 306.3.4)</b>	Yes
<b>30" x 48" clear floor space for forward approach (ADA 602.2)</b>	Yes
<b>Spout no more than 36" max. AFF (ADA 602.4)</b>	Yes
<b>Spout located 15" min from the vertical support and 5" max from the front ledge of the unit. (ADA 602.5)</b>	Yes
<b>Water flow height is at least 4" (ADA 602.6)</b>	Yes
<b>Operable parts operable with one hand and do not require tight grasping, pinching, or twisting of the wrist. (ADA 309.4)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

### Drinking Fountain Photos



## Elevator




<b>Elevator location</b>	Main Entrance
<b>Status of elevator</b>	Operational
<b>Car self-level to within 1/2" (ADA 407.4.4)</b>	Yes
<b>Is the minimum clear width of the accessible route to the elevators at least 36" wide, with no steps (ADA 403.5.1)</b>	Yes
<b>Hall call buttons at 48" max AFF as measured to centerline of highest operable part. (ADA 407.2.1)</b>	Yes
<b>Hall lanterns- Above each elevator door is there a visible and audible signal that indicates which car is answering a call (ADA 407.2.2.1)</b>	Yes
<b>Do audible signals sound once for UP and twice for DOWN (ADA 407.2.2.3)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

Do both jambs have floor signs 2" min. tactile characters and braille centered at 60" AFF (ADA 407.2.3.1)	No
Door to one side, car at least 51" deep and 68" wide (measured from panel to panel) (ADA 407.4.1)	Yes
All floor buttons no higher than 48" max. AFF (ADA 407.4.6.1 and 308)	Yes
Emergency controls including alarm/stop, are grouped at the bottom of the panel with centerlines no less than 35" (ADA 407.4.6.4)	No
Elevator Photos	

## Accessibility Site Visit Report - HC - ANSI

### Fitness Center

<b>Location of Fitness Center</b>	Basement
<b>Status of this area</b>	Finished stage
<b>Interior signs mounted (latch side) have tactile characters (measured from the baseline) between 48" min. - 60" max. (ADA 703.4.1)</b>	Yes
<b>Interior sign characters at least 5/8" but no more than 2" tall (ADA 703.2.5)</b>	Yes
<b>Doorway has a clear opening width 32" min. (ADA 404.2.3)</b>	Yes
<b>Threshold less than 1/2" with bevel or 1/4" no bevel (ADA 404.2.5 UFAS 4.13.8)</b>	Yes
<b>12" min. clearance on push side of the door (with door closure) (ADA 404.2.1)</b>	Yes
<b>Does the door take at least 5 seconds to close (2010 ADA 404.28.1)</b>	Yes
<b>Electric switches 48" max. AFF and outlets 15" min. (unobstructed) (ADA 308.2.1)</b>	Yes
<b>Clear floor space of 30" X 48" provided at each type of equipment (this space permitted to overlap) (ADA 1004.1)</b>	Yes
<b>Fitness Center Photos</b>	  

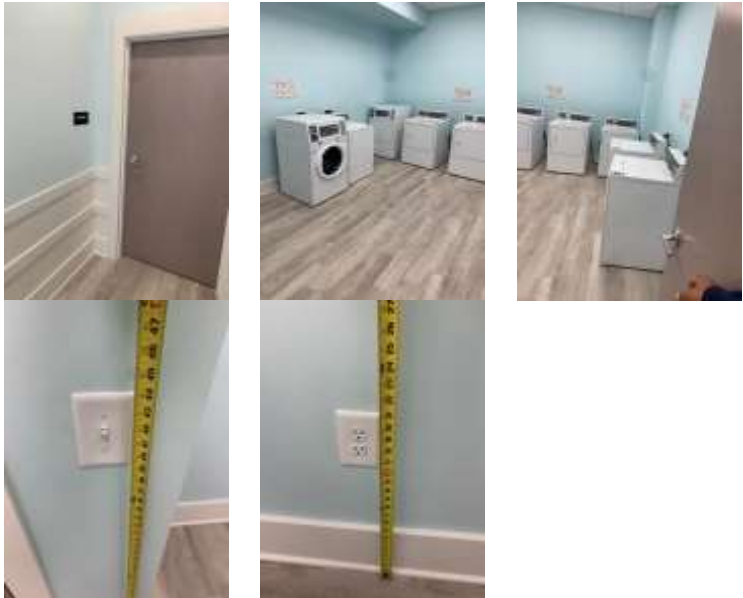
## Accessibility Site Visit Report - HC - ANSI



### Laundry Area

<b>Location of Laundry Area</b>	Basement Entrance
<b>Status of this area</b>	Finished stage
<b>Doorway has a clear opening width 32" min. (ADA 404.2.3)</b>	Yes
<b>Door hardware does not require tight grasping or twisting to operate (ADA 404.2.7, 309.4)</b>	Yes
<b>Threshold less than 1/2" with bevel or 1/4" no bevel (ADA 404.2.5, UFAS 4.13.8)</b>	Yes
<b>12" min. clearance on the push side of the door (with door closure) (ADA 404.2.1)</b>	Yes
<b>Does the door take at least 5 seconds to close (2010 ADA 404.2.8.1)</b>	Yes
<b>Interior signs mounted (latch side) have tactile characters (measured from the baseline) between 48" min. - 60" max. (ADA 703.4.1)</b>	Yes
<b>Interior sign characters at least 5/8" but no more than 2" tall (ADA 703.5.5)</b>	Yes
<b>Electric switches 48" max. AFF and outlets 15" min. (unobstructed) (ADA 308.2.1)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI


Front loading machines provided with parallel approach clear floor space 30" x 48" (ADA 611.4)	Yes
Equipment controls 48" max. AFF (ADA 309)	Yes
Front loading machine with bottom of the opening to the laundry compartment located 15" min - 36" max AFF (ADA 611.4)	Yes
Laundry Area Photos	

## Leasing Office

Location of Leasing Office	Basement Entrance Community Room
Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ADA 404.2.3)	Yes
Door hardware does not require tight grasping or twisting to operate (ADA 404.2.7 309.4)	Yes




## Accessibility Site Visit Report - HC - ANSI

Threshold less than 1/2" with bevel or 1/4" no bevel (ADA 404.2.5 UFAS 4.13.8)	Yes
18" min. clearance on the pull side of the door (no door closure) (ADA 404.2.4.1)	Yes
Does the door take at least 5 seconds to close (2010 ADA 404.2.8.1)	Yes
Interior signs mounted (latch side) have tactile characters (measured from the baseline) between 48" min. - 60" max. (ADA 703.4.1)	Yes
Electric switches 48" max. AFF and outlets 15" min. (unobstructed) (ADA 308.2.1)	Yes
Leasing Office Photos	

## Mail Area

Mail Area Location	Basement
Status of this area	Finished

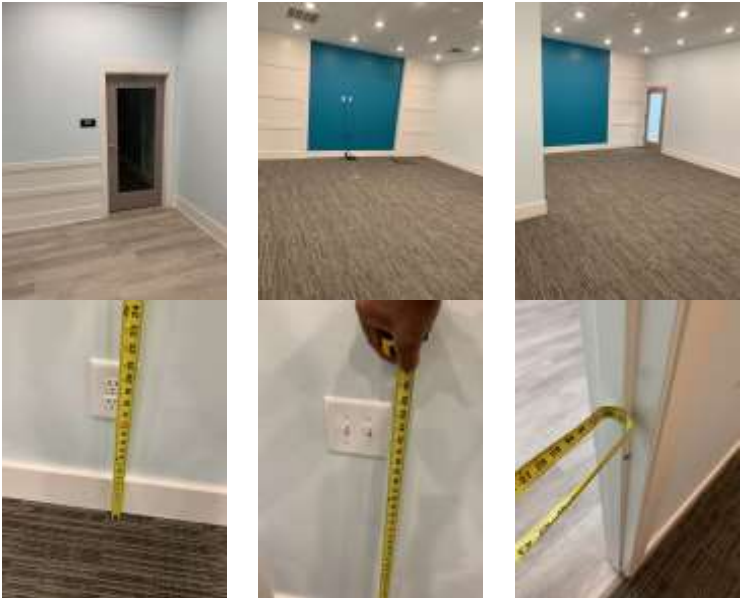
## Accessibility Site Visit Report - HC - ANSI

Is the minimum clear width of the accessible route to the mailboxes at least 36" wide	Yes
Doorway has a clear opening width 32" min. (ADA 404.2.3)	Yes
Is the clear floor space centered on mailbox 30" x 48" unobstructed (ADA 309.2 305)	Yes
Is at least one outbound mail slot 48" max. AFF	Yes
Does the mail area provide 60" x 60" accessible turning (ADA 304.3.1)	Yes
Mail Area Photos	

## Other Community Area

Description of Community Area	Media Center
Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ADA 404.2.3)	Yes
Threshold less than 1/2" with bevel or 1/4" no bevel	Yes
12" min. clearance on push side of the door (with door closure)	Yes
Does the door take at least 5 seconds to close (2010 ADA 404.28.1)	Yes

## Accessibility Site Visit Report - HC - ANSI

Interior signs mounted (latch side) have tactile characters (measured from the baseline) between 48" min. - 60" max. (ADA 703.4.1)	Yes
Interior sign characters at least 5/8" but no more than 2" tall	Yes
Electric switches 48" max. AFF and outlets 15" min.	Yes
Other Community Area Photos	

## Public Restroom

Public Restroom Description	Basement Entrance Men's
Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ADA 404.2.3)	Yes
Door hardware does not require tight grasping or twisting to operate (ADA 404.2.7 309.4)	Yes
Threshold less than 1/2" with bevel or 1/4" no bevel (ADA 404.2.5 UFAS 4.13.8)	Yes

## Accessibility Site Visit Report - HC - ANSI

<b>12" min. clearance on the push side of the door (with door closure) (ADA 404.2.1)</b>	Yes
<b>Interior signs mounted (latch side) have tactile characters (measured from the baseline) between 48" min. - 60" max. (ADA 703.4.1)</b>	Yes
<b>Interior sign characters at least 5/8" but no more than 2" tall (ADA 703.2.5)</b>	Yes
<b>Does the door take at least 5 seconds to close (2010 ADA 404.2.8.1)</b>	Yes
<b>Electric switches 46" max. (obstructed) 48" max. AFF (unobstructed) (ADA 308)</b>	Yes
<b>Coat hooks and shelves 40" min AFF 48" max. AFF (ADA 603.4)</b>	Yes
<b>Urinal provided in restroom</b>	Yes
<b>Toilet paper dispenser 19" min. - 48" max. AFF and 7" - 9" from front lip of toilet (ADA 604.7)</b>	Yes
<b>Soap dispenser, paper towel, coat hook, etc. 48" max. with 30" x 48" clear floor space (ADA 308)</b>	Yes
<b>Mirror mounted with bottom edge of the reflecting surface 40" max. AFF (ADA 603.3)</b>	Yes
<b>In all other toilet rooms, is there an unobstructed turning space (60" diameter circle or T-shape) (ADA 603.2.1, 304.3.1)</b>	Yes
<b>If required per NFPA fire alarm permanently installed with audible/visible alarms</b>	Yes


## Accessibility Site Visit Report - HC - ANSI

### Restroom Photos

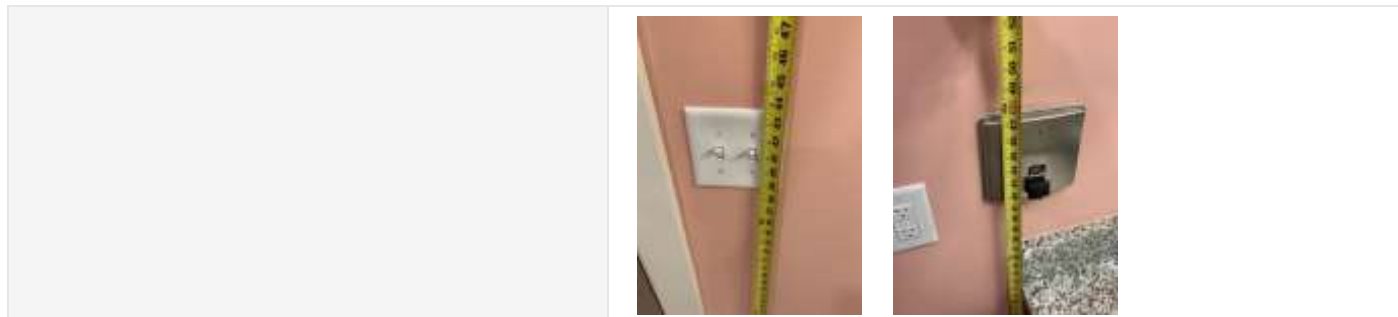


Public Restroom Description	Basement Entrance Women's
Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ADA 404.2.3)	Yes
Door hardware does not require tight grasping or twisting to operate (ADA 404.2.7 309.4)	Yes
Threshold less than 1/2" with bevel or 1/4" no bevel (ADA 404.2.5 UFAS 4.13.8)	Yes
12" min. clearance on the push side of the door (with door closure) (ADA 404.2.1)	Yes
Interior signs mounted (latch side) have tactile characters (measured from the baseline) between 48" min. - 60" max. (ADA 703.4.1)	Yes
Interior sign characters at least 5/8" but no more than 2" tall (ADA 703.2.5)	Yes

## Accessibility Site Visit Report - HC - ANSI

<b>Does the door take at least 5 seconds to close (2010 ADA 404.2.8.1)</b>	Yes
<b>Electric switches 46" max. (obstructed) 48" max. AFF (unobstructed) (ADA 308)</b>	Yes
<b>Coat hooks and shelves 40" min AFF 48" max. AFF (ADA 603.4)</b>	Yes
<b>Toilet paper dispenser 19" min. - 48" max. AFF and 7" - 9" from front lip of toilet (ADA 604.7)</b>	Yes
<b>Soap dispenser, paper towel, coat hook, etc. 48" max. with 30" x 48" clear floor space (ADA 308)</b>	Yes
<b>Mirror mounted with bottom edge of the reflecting surface 40" max. AFF (ADA 603.3)</b>	Yes
<b>In all other toilet rooms, is there an unobstructed turning space (60" diameter circle or T-shape) (ADA 603.2.1, 304.3.1)</b>	Yes
<b>If required per NFPA fire alarm permanently installed with audible/visible alarms</b>	Yes
<b>Restroom Photos</b>	

## Accessibility Site Visit Report - HC - ANSI




### Stairways

<b>Location of stairway</b>	Stairway 1
<b>Status of Stairways - Handrails</b>	Finished
<b>All steps on a flight of stairs have uniform riser heights and uniform tread depths (ADA 504.2)</b>	Yes
<b>Stairway components, such as stringers, treads, and risers constructed from steel or concrete.</b>	Yes
<b>Riser height 4" min. - 7" max. (ADA 504.2)</b>	Yes
<b>Tread depth 11" min (ADA 504.2)</b>	Yes
<b>No open risers found at stairway (ADA 504.3)</b>	Yes
<b>Handrails on both sides of stairs 34" min. - 38" max. height (ADA 505.4)</b>	Yes
<b>Clearance between handrail gripping surface and adjacent surfaces is 1 1/2" min (ADA 505.5)</b>	Yes
<b>Circular cross section of handrail outside diameter 1 1/4" min and 2" max (ADA 505.7.1)</b>	Yes
<b>Top extension at stairs extend horizontally above the landing for 12"</b>	Yes




## Accessibility Site Visit Report - HC - ANSI

min. beginning directly above the first riser nosing (ADA 505.10.2)	
Bottom extension extends at the slope of the stair flight for a horizontal distance at least equal to one tread depth beyond the last riser nosing (ADA 505.10.3)	Yes
Stairway Photos	

Location of stairway	Stairway 2
Status of Stairways - Handrails	Finished
All steps on a flight of stairs have uniform riser heights and uniform tread depths (ADA 504.2)	Yes
Stairway components, such as stringers, treads, and risers constructed from steel or concrete.	Yes
Riser height 4" min. - 7" max. (ADA 504.2)	Yes
Tread depth 11" min (ADA 504.2)	Yes

## Accessibility Site Visit Report - HC - ANSI


No open risers found at stairway (ADA 504.3)	Yes
Handrails on both sides of stairs 34" min. - 38" max. height (ADA 505.4)	Yes
Clearance between handrail gripping surface and adjacent surfaces is 1 1/2" min (ADA 505.5)	Yes
Circular cross section of handrail outside diameter 1 1/4" min and 2" max (ADA 505.7.1)	Yes
Top extension at stairs extend horizontally above the landing for 12" min. beginning directly above the first riser nosing (ADA 505.10.2)	Yes
Bottom extension extends at the slope of the stair flight for a horizontal distance at least equal to one tread depth beyond the last riser nosing (ADA 505.10.3)	Yes
Stairway Photos	

## HC UNIT

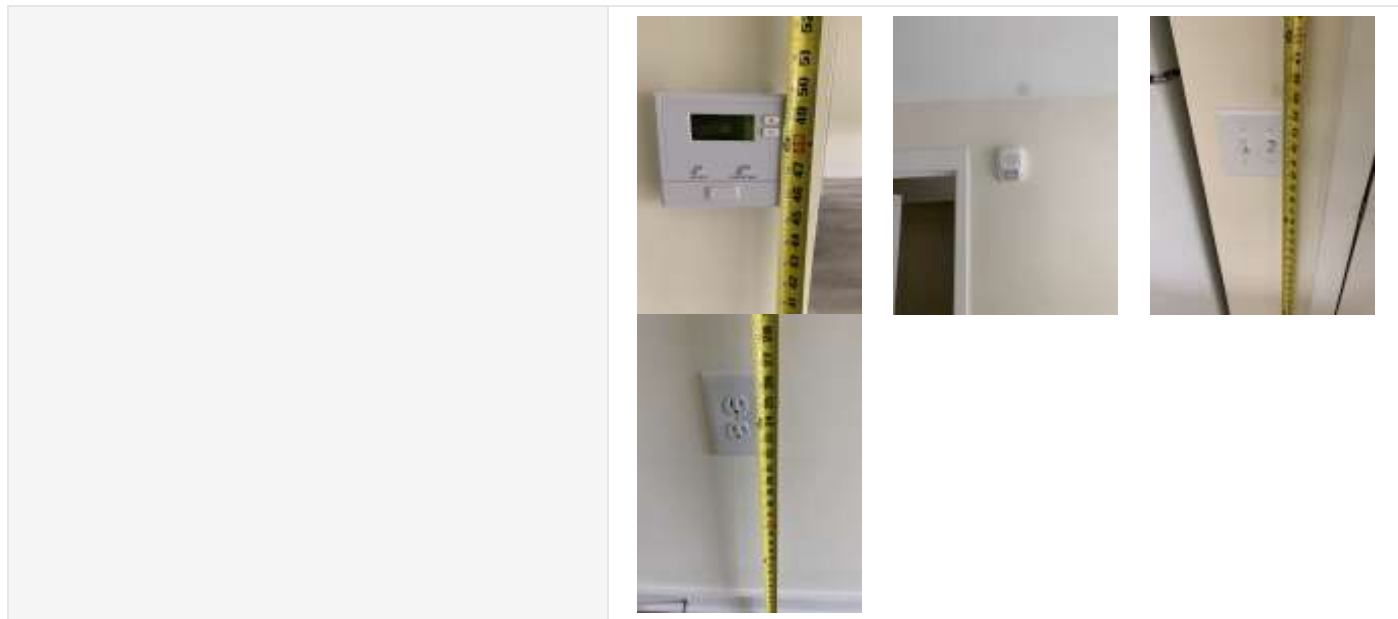
### HC Unit Entrance

Unit Number	8109
Exterior unit sign mounted have braille between 48" min. - 60" max.(ADA 216.2)	Yes
Number of HC Bedrooms	1

## Accessibility Site Visit Report - HC - ANSI

Type of shower/bath	Roll-in Shower
Entrance landing 60" x 60" (Pull side) or 48" x 48" (Push side) with slope 2% or less in all directions (ANSI 404.2)	Yes
Primary Entrance has lower peephole 43" min. - 48" max. AFF (ANSI 404.2.10)	Yes
Primary Entrance - Door hardware lever handle style (ANSI 404.2.6)	Yes
Primary Entrance - clear width 32" min. (ANSI 404.2.2)	Yes
Primary Threshold less than 1/2" with bevel (ANSI 303.3)	Yes
Primary Entrance - 18" min. clearance on pull side of the door (ANSI Table 404.2.3.2)	Yes
Unobstructed thermostat 48" max. AFF (ANSI 308.2)	No
36" min width accessible route through dwelling unit (ANSI 403.5)	Yes
Hallway 48" min width with doors to rooms intended for entry swinging into same area intended for passage (ANSI Fig 404.2.3.2)	Yes
If required per NFPA fire alarm permanently installed with audible/visible alarms	Yes
Photos for HC Unit Misc.	

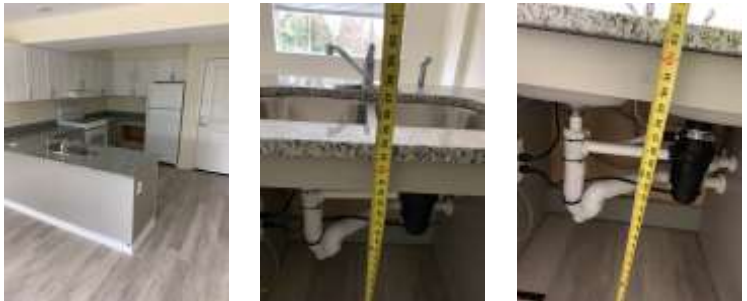
## Accessibility Site Visit Report - HC - ANSI



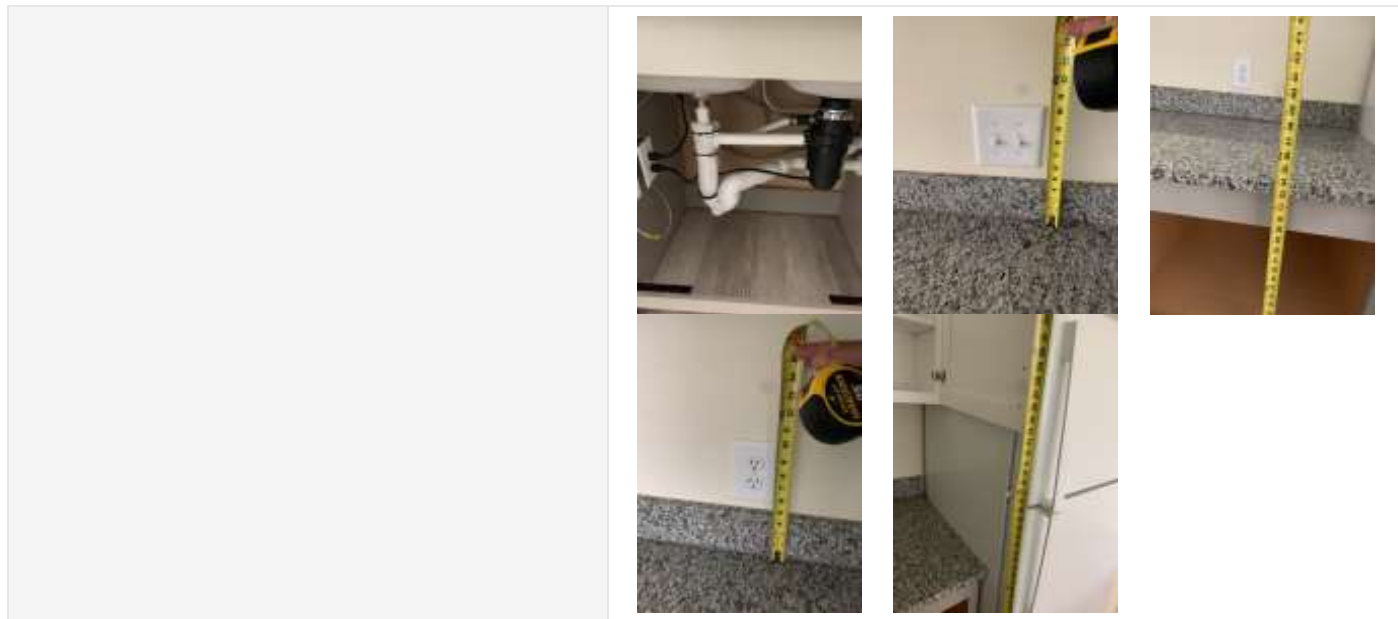
### HC Unit Kitchen

Status of this area	Finished stage
Entrance to kitchen 32" min. (ANSI 404.2.2)	Yes
Electric switches/outlets 46" max. AFF over 24" counter-top obstruction (ANSI 308.3.2)	Yes
Kitchen counter at workspace 34" max. AFF (ANSI 804.3 & 308.3.2)	Yes
Removable cabinet provided at sink with necessary knee clearance for forward approach provided (ANSI 305 & 306))	Yes
Top lip of kitchen sink, 34" max. AFF (ANSI 606.3))	Yes
Are drain and water supply pipes insulated or covered by skirt (ANSI 606.6)	Yes


## Accessibility Site Visit Report - HC - ANSI

<b>Faucet controls Lever Handle style or easy to operate (ANSI 309.4)</b>	Yes
<b>U-Shaped kitchen has 60" min. clear width (ANSI 804.2.2)</b>	Yes
<b>Clear floor for parallel approach is provided or forward approach to kitchen sink has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ANSI 804.5.3)</b>	Yes
<b>Workspace has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ANSI 306))</b>	Yes
<b>Cabinet hardware easily operated with one hand (ANSI 309.4)</b>	Yes
<b>Range hood fan/light switches installed within accessible reach range 44" max. AFF over workspace others 46" max. AFF (ANSI 309.4))</b>	Yes
<b>Range has controls located in front and oven self-cleaning (required if workspace not located adjacent to oven)</b>	Yes
<b>Refrigerator has 50% of freezer space below 54" max. AFF (ANSI 804.5.6)</b>	Yes
<b>HC Unit Kitchen Photos</b>	

## Accessibility Site Visit Report - HC - ANSI



## HC - Bathroom Blocking

<b>Status of Blocking</b>	Covered by drywall
<b>FHA &amp; HC Units - All bathrooms required to have blocking.</b>	In FHA & HC Units ALL bathrooms required to have blocking.
<b>Bathroom Blocking Photos</b>	

## HC Unit Bathroom

<b>Status of this area</b>	Finished stage
<b>Doorway has a clear opening width 32" min. (ANSI 404.2.2)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

Door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))	Yes
Threshold less than 1/2" with bevel or 1/4" no bevel (ANSI 303.3))	Yes
18" min. clearance on the pull side of the door (ANSI Table 404.2.3.2)	Yes
Electric switches 48" max AFF (unobstructed) or 46" max AFF (obstructed). (ANSI 308.3.2))	Yes
Toilet (Elements indicated are NOT compliant) (ANSI 603 & 604)	Toilet centerline exactly 18" from the closest side wall. ANSI 604.2 calls for 16" min – 18" max from nearest side wall.
Toilet paper dispenser 19" min. AFF and 7" - 9" from front lip of toilet (ANSI 604)	No
Mirror mounted with the bottom edge of the reflecting surface 40" max. AFF (ANSI 603.3)	Yes
Shower provided in unit (leave blank if not)	Yes
HC Shower (Elements indicated are NOT compliant) (ANSI 608)	Shower spray flex hose 59" with hand sprayer on slide mount within 48" max. AFF
Unobstructed Turning Space: If there are only 1 lavatory and 1 toilet, is there a 30" x 60" clear floor space beyond the swing of door (ANSI 604)	Yes
If required per NFPA fire alarm permanently installed with audible/visible alarms	Yes
Additional Comments for HC Bathroom	



## Accessibility Site Visit Report - HC - ANSI

### HC Bathroom Photos



### HC Unit BR

<b>Status of this area</b>	Finished stage
<b>Doorway has a clear opening width 32" min. (ANSI 404.2.2)</b>	Yes
<b>Door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))</b>	Yes
<b>Threshold less than 1/2" with bevel or 1/4" no bevel (ANSI 303.3))</b>	Yes
<b>18" min. clearance on the pull side of the door (ANSI Table 404.2.3.2)</b>	Yes
<b>Electric switches 48" max. AFF and outlets 15" min. (ANSI 308)</b>	Yes
<b>Closet door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))</b>	Yes
<b>Closet clothes rod and shelving hardware 48" max. AFF (ANSI 308)</b>	Yes
<b>Closet door has clear width of 32" (ANSI 404.2.2)</b>	Yes
<b>If required per NFPA fire alarm permanently installed with audible alarm</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

### HC Bedroom Photos






## HC UNIT

### HC Unit Entrance

<b>Unit Number</b>	8209
<b>Exterior unit sign mounted have braille between 48" min. - 60" max.(ADA 216.2)</b>	Yes
<b>Number of HC Bedrooms</b>	1
<b>Type of shower/bath</b>	Roll-in Shower
<b>Entrance landing 60" x 60" (Pull side) or 48" x 48" (Push side) with slope 2% or less in all directions (ANSI 404.2)</b>	Yes
<b>Primary Entrance has lower peephole 43" min. - 48" max. AFF (ANSI 404.2.10)</b>	Yes
<b>Primary Entrance - Door hardware lever handle style (ANSI 404.2.6)</b>	Yes
<b>Primary Entrance - clear width 32" min. (ANSI 404.2.2)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

Primary Threshold less than 1/2" with bevel (ANSI 303.3)	Yes
Primary Entrance - 18" min. clearance on pull side of the door (ANSI Table 404.2.3.2)	Yes
Entry Closet provides 30" x 48" clear floor space for forward or parallel approach (ANSI 905.2)	N/A
Unobstructed thermostat 48" max. AFF (ANSI 308.2)	<b>No</b>
36" min width accessible route through dwelling unit (ANSI 403.5)	Yes
Hallway 48" min width with doors to rooms intended for entry swinging into same area intended for passage (ANSI Fig 404.2.3.2)	Yes
Unobstructed main electric panel top breaker 48" max. AFF (ANSI 308.2)	Yes
If required per NFPA fire alarm permanently installed with audible/visible alarms	Yes
Photos for HC Unit Misc.	  

## HC Unit Kitchen

Status of this area	Finished stage
Entrance to kitchen 32" min. (ANSI 404.2.2)	Yes

## Accessibility Site Visit Report - HC - ANSI



<b>Electric switches/outlets 46" max. AFF over 24" counter-top obstruction (ANSI 308.3.2)</b>	Yes
<b>Kitchen counter at workspace 34" max. AFF (ANSI 804.3 &amp; 308.3.2)</b>	Yes
<b>Removable cabinet provided at sink with necessary knee clearance for forward approach provided (ANSI 305 &amp; 306))</b>	Yes
<b>Top lip of kitchen sink, 34" max. AFF (ANSI 606.3))</b>	Yes
<b>Are drain and water supply pipes insulated or covered by skirt (ANSI 606.6)</b>	Yes
<b>Faucet controls Lever Handle style or easy to operate (ANSI 309.4)</b>	Yes
<b>U-Shaped kitchen has 60" min. clear width (ANSI 804.2.2)</b>	Yes
<b>Clear floor for parallel approach is provided or forward approach to kitchen sink has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ANSI 804.5.3)</b>	Yes
<b>Workspace has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ANSI 306))</b>	Yes
<b>Cabinet hardware easily operated with one hand (ANSI 309.4)</b>	Yes
<b>Range hood fan/light switches installed within accessible reach range 44" max. AFF over workspace others 46" max. AFF (ANSI 309.4))</b>	Yes
<b>Range has controls located in front and oven self-cleaning (required if workspace not located adjacent to oven)</b>	Yes
<b>Refrigerator has 50% of freezer space below 54" max. AFF (ANSI 804.5.6)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

### HC Unit Kitchen Photos




## HC - Bathroom Blocking

<b>Status of Blocking</b>	Covered by drywall
<b>FHA &amp; HC Units - All bathrooms required to have blocking.</b>	In FHA & HC Units ALL bathrooms required to have blocking.
<b>Bathroom Blocking Photos</b>	 

## HC Unit Bathroom

<b>Status of this area</b>	Finished stage
<b>Doorway has a clear opening width 32" min. (ANSI 404.2.2)</b>	Yes
<b>Door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))</b>	Yes
<b>Threshold less than 1/2" with bevel or 1/4" no bevel (ANSI 303.3))</b>	Yes
<b>18" min. clearance on the pull side of the door (ANSI Table 404.2.3.2)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

Electric switches 48" max AFF (unobstructed) or 46" max AFF (obstructed). (ANSI 308.3.2)	Yes
Toilet paper dispenser 19" min. AFF and 7" - 9" from front lip of toilet (ANSI 604)	No
Mirror mounted with the bottom edge of the reflecting surface 40" max. AFF (ANSI 603.3)	Yes
HC Shower (Elements indicated are NOT compliant) (ANSI 608)	Shower spray flex hose 59" with hand sprayer on slide mount within 48" max. AFF
Unobstructed Turning Space: If there are only 1 lavatory and 1 toilet, is there a 30" x 60" clear floor space beyond the swing of door (ANSI 604)	Yes
If required per NFPA fire alarm permanently installed with audible/visible alarms	Yes
HC Bathroom Photos	

## HC Unit BR

Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ANSI 404.2.2)	Yes

## Accessibility Site Visit Report - HC - ANSI


<b>Door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))</b>	Yes
<b>Threshold less than 1/2" with bevel or 1/4" no bevel (ANSI 303.3))</b>	Yes
<b>18" min. clearance on the pull side of the door (ANSI Table 404.2.3.2)</b>	Yes
<b>Electric switches 48" max. AFF and outlets 15" min. (ANSI 308)</b>	Yes
<b>Closet door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))</b>	Yes
<b>Closet clothes rod and shelving hardware 48" max. AFF (ANSI 308)</b>	Yes
<b>Closet door has clear width of 32" (ANSI 404.2.2)</b>	Yes
<b>If required per NFPA fire alarm permanently installed with audible alarm</b>	Yes

## HC UNIT

### HC Unit Entrance

<b>Unit Number</b>	8309
<b>Exterior unit sign mounted have braille between 48" min. - 60" max.(ADA 216.2)</b>	Yes
<b>Number of HC Bedrooms</b>	1
<b>Type of shower/bath</b>	Roll-in Shower

## Accessibility Site Visit Report - HC - ANSI

Photos for HC Unit Misc.	
Additional Comments for 8309	Unit locked, could not make entry

## HC - Bathroom Blocking

FHA & HC Units - All bathrooms required to have blocking.	In FHA & HC Units ALL bathrooms required to have blocking.
---	--


## HC UNIT

### HC Unit Entrance

Unit Number	8409
Exterior unit sign mounted have braille between 48" min. - 60" max.(ADA 216.2)	Yes
Number of HC Bedrooms	1
Type of shower/bath	Roll-in Shower
Entrance landing 60" x 60" (Pull side) or 48" x 48" (Push side) with slope 2% or less in all directions (ANSI 404.2)	Yes
Primary Entrance has lower peephole 43" min. - 48" max. AFF (ANSI 404.2.10)	Yes
Primary Entrance - Door hardware lever handle style (ANSI 404.2.6)	Yes
Primary Entrance - clear width 32" min. (ANSI 404.2.2)	Yes



## Accessibility Site Visit Report - HC - ANSI

Primary Threshold less than 1/2" with bevel (ANSI 303.3)	Yes
Primary Entrance - 18" min. clearance on pull side of the door (ANSI Table 404.2.3.2)	Yes
Unobstructed thermostat 48" max. AFF (ANSI 308.2)	No
36" min width accessible route through dwelling unit (ANSI 403.5)	Yes
Hallway 48" min width with doors to rooms intended for entry swinging into same area intended for passage (ANSI Fig 404.2.3.2)	Yes
Unobstructed main electric panel top breaker 48" max. AFF (ANSI 308.2)	Yes
If required per NFPA fire alarm permanently installed with audible/visible alarms	Yes
Photos for HC Unit Misc.	

## HC Unit Kitchen

Status of this area	Finished stage
Entrance to kitchen 32" min. (ANSI 404.2.2)	Yes
Electric switches/outlets 46" max. AFF over 24" counter-top obstruction (ANSI 308.3.2)	Yes

## Accessibility Site Visit Report - HC - ANSI

<b>Kitchen counter at workspace 34" max. AFF (ANSI 804.3 &amp; 308.3.2)</b>	Yes
<b>Removable cabinet provided at sink with necessary knee clearance for forward approach provided (ANSI 305 &amp; 306))</b>	Yes
<b>Top lip of kitchen sink, 34" max. AFF (ANSI 606.3))</b>	Yes
<b>Are drain and water supply pipes insulated or covered by skirt (ANSI 606.6)</b>	Yes
<b>Faucet controls Lever Handle style or easy to operate (ANSI 309.4)</b>	Yes
<b>U-Shaped kitchen has 60" min. clear width (ANSI 804.2.2)</b>	Yes
<b>Clear floor for parallel approach is provided or forward approach to kitchen sink has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ANSI 804.5.3)</b>	Yes
<b>Workspace has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ANSI 306))</b>	Yes
<b>Cabinet hardware easily operated with one hand (ANSI 309.4)</b>	Yes
<b>Range hood fan/light switches installed within accessible reach range 44" max. AFF over workspace others 46" max. AFF (ANSI 309.4))</b>	Yes
<b>Range has controls located in front and oven self-cleaning (required if workspace not located adjacent to oven)</b>	Yes
<b>Refrigerator has 50% of freezer space below 54" max. AFF (ANSI 804.5.6)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

### HC Unit Kitchen Photos



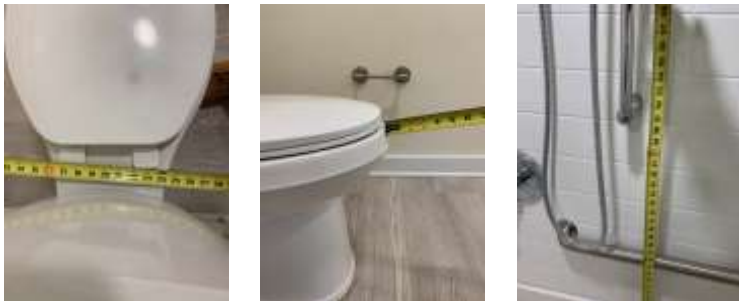
## HC - Bathroom Blocking

Status of Blocking	Covered by drywall
FHA & HC Units - All bathrooms required to have blocking.	In FHA & HC Units ALL bathrooms required to have blocking.

## HC Unit Bathroom

Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ANSI 404.2.2)	Yes
Door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))	Yes
Threshold less than 1/2" with bevel or 1/4" no bevel (ANSI 303.3))	Yes
18" min. clearance on the pull side of the door (ANSI Table 404.2.3.2)	Yes
Electric switches 48" max AFF (unobstructed) or 46" max AFF (obstructed). (ANSI 308.3.2))	Yes
Toilet (Elements indicated are NOT compliant) (ANSI 603 & 604)	Toilet centerline exactly 18" from the closest side wall. ANSI 604.2 calls for 16" min – 18" max from nearest side wall.
Toilet paper dispenser 19" min. AFF and 7" - 9" from front lip of toilet (ANSI 604)	No

## Accessibility Site Visit Report - HC - ANSI

Mirror mounted with the bottom edge of the reflecting surface 40" max. AFF (ANSI 603.3)	Yes
Shower provided in unit (leave blank if not)	Yes
HC Shower (Elements indicated are NOT compliant) (ANSI 608)	Shower spray flex hose 59" with hand sprayer on slide mount within 48" max. AFF
Unobstructed Turning Space: If there are only 1 lavatory and 1 toilet, is there a 30" x 60" clear floor space beyond the swing of door (ANSI 604)	Yes
If required per NFPA fire alarm permanently installed with audible/visible alarms	Yes
HC Bathroom Photos	

## HC Unit BR

Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ANSI 404.2.2)	Yes
Door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))	Yes
Threshold less than 1/2" with bevel or 1/4" no bevel (ANSI 303.3))	Yes
18" min. clearance on the pull side of the door (ANSI Table 404.2.3.2)	Yes

## Accessibility Site Visit Report - HC - ANSI


<b>Electric switches 48" max. AFF and outlets 15" min. (ANSI 308)</b>	Yes
<b>Closet door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))</b>	Yes
<b>Closet clothes rod and shelving hardware 48" max. AFF (ANSI 308)</b>	Yes
<b>Closet door has clear width of 32" (ANSI 404.2.2)</b>	Yes
<b>If required per NFPA fire alarm permanently installed with audible alarm</b>	Yes

## HC UNIT

### HC Unit Entrance

<b>Unit Number</b>	8509
<b>Exterior unit sign mounted have braille between 48" min. - 60" max.(ADA 216.2)</b>	Yes
<b>Number of HC Bedrooms</b>	1
<b>Type of shower/bath</b>	Roll-in Shower
<b>Entrance landing 60" x 60" (Pull side) or 48" x 48" (Push side) with slope 2% or less in all directions (ANSI 404.2)</b>	Yes
<b>Primary Entrance has lower peephole 43" min. - 48" max. AFF (ANSI 404.2.10)</b>	Yes
<b>Primary Entrance - Door hardware lever handle style (ANSI 404.2.6)</b>	Yes
<b>Primary Entrance - clear width 32" min. (ANSI 404.2.2)</b>	Yes
<b>Primary Threshold less than 1/2" with bevel (ANSI 303.3)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

<b>Primary Entrance - 18" min. clearance on pull side of the door (ANSI Table 404.2.3.2)</b>	Yes
<b>Unobstructed thermostat 48" max. AFF (ANSI 308.2)</b>	<b>No</b>
<b>36" min width accessible route through dwelling unit (ANSI 403.5)</b>	Yes
<b>Hallway 48" min width with doors to rooms intended for entry swinging into same area intended for passage (ANSI Fig 404.2.3.2)</b>	Yes
<b>Unobstructed main electric panel top breaker 48" max. AFF (ANSI 308.2)</b>	Yes
<b>If required per NFPA fire alarm permanently installed with audible/visible alarms</b>	Yes
<b>Photos for HC Unit Misc.</b>	

## HC Unit Kitchen

<b>Status of this area</b>	Finished stage
<b>Entrance to kitchen 32" min. (ANSI 404.2.2)</b>	Yes
<b>Electric switches/outlets 46" max. AFF over 24" counter-top obstruction (ANSI 308.3.2)</b>	Yes
<b>Kitchen counter at workspace 34" max. AFF (ANSI 804.3 &amp; 308.3.2)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

<b>Removable cabinet provided at sink with necessary knee clearance for forward approach provided (ANSI 305 &amp; 306))</b>	Yes
<b>Top lip of kitchen sink, 34" max. AFF (ANSI 606.3))</b>	Yes
<b>Are drain and water supply pipes insulated or covered by skirt (ANSI 606.6)</b>	Yes
<b>Faucet controls Lever Handle style or easy to operate (ANSI 309.4)</b>	Yes
<b>U-Shaped kitchen has 60" min. clear width (ANSI 804.2.2)</b>	Yes
<b>Clear floor for parallel approach is provided or forward approach to kitchen sink has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ANSI 804.5.3)</b>	Yes
<b>Workspace has 27" knee clearance, 30" clear width, and 9" min. height toe clearance (ANSI 306))</b>	Yes
<b>Cabinet hardware easily operated with one hand (ANSI 309.4)</b>	Yes
<b>Range hood fan/light switches installed within accessible reach range 44" max. AFF over workspace others 46" max. AFF (ANSI 309.4))</b>	Yes
<b>Range has controls located in front and oven self-cleaning (required if workspace not located adjacent to oven)</b>	Yes
<b>Refrigerator has 50% of freezer space below 54" max. AFF (ANSI 804.5.6)</b>	Yes

## Accessibility Site Visit Report - HC - ANSI

### HC - Bathroom Blocking


<b>Status of Blocking</b>	Covered by drywall
<b>FHA &amp; HC Units - All bathrooms required to have blocking.</b>	In FHA & HC Units ALL bathrooms required to have blocking.

### HC Unit Bathroom

<b>Status of this area</b>	Finished stage
<b>Doorway has a clear opening width 32" min. (ANSI 404.2.2)</b>	Yes
<b>Door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))</b>	Yes
<b>Threshold less than 1/2" with bevel or 1/4" no bevel (ANSI 303.3))</b>	Yes
<b>18" min. clearance on the pull side of the door (ANSI Table 404.2.3.2)</b>	Yes
<b>Electric switches 48" max AFF (unobstructed) or 46" max AFF (obstructed). (ANSI 308.3.2))</b>	Yes
<b>Toilet paper dispenser 19" min. AFF and 7" - 9" from front lip of toilet (ANSI 604)</b>	<b>No</b>
<b>Mirror mounted with the bottom edge of the reflecting surface 40" max. AFF (ANSI 603.3)</b>	Yes
<b>Shower provided in unit (leave blank if not)</b>	Yes
<b>HC Shower (Elements indicated are NOT compliant) (ANSI 608)</b>	<b>Shower spray flex hose 59" with hand sprayer on slide mount within 48" max. AFF</b>
<b>Unobstructed Turning Space: If there are only 1 lavatory and 1 toilet, is there a 30" x 60" clear floor space beyond the swing of door (ANSI 604)</b>	Yes



## Accessibility Site Visit Report - HC - ANSI

If required per NFPA fire alarm permanently installed with audible/visible alarms	Yes
HC Bathroom Photos	

## HC Unit BR

Status of this area	Finished stage
Doorway has a clear opening width 32" min. (ANSI 404.2.2)	Yes
Door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))	Yes
Threshold less than 1/2" with bevel or 1/4" no bevel (ANSI 303.3))	Yes
18" min. clearance on the pull side of the door (ANSI Table 404.2.3.2)	Yes
Electric switches 48" max. AFF and outlets 15" min. (ANSI 308)	Yes
Closet door hardware does not require tight grasping or twisting to operate (ANSI 404.2.6))	Yes
Closet clothes rod and shelving hardware 48" max. AFF (ANSI 308)	Yes
Closet door has clear width of 32" (ANSI 404.2.2)	Yes
If required per NFPA fire alarm permanently installed with audible alarm	Yes

**Accessibility Site Visit Report - HC - ANSI**